
### plugin 1019

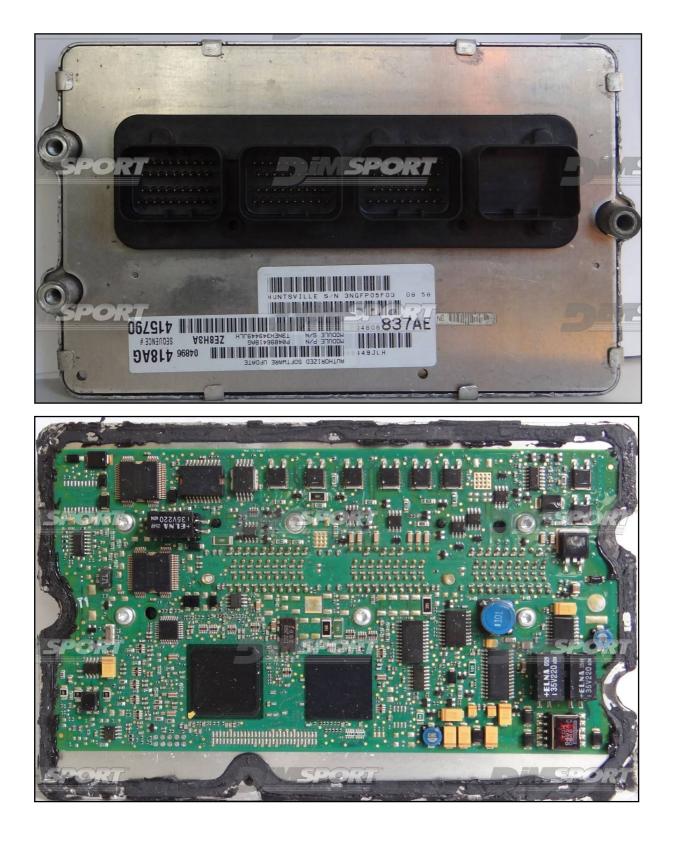

#### DIRECT CONNECTION

In order to connect to the ECU use the cable F32GN037C.

Make sure that the POWER led (red) on Trasdata is ON.

These connections are required for all the connection approaches: soldering adapter or metal positioning frame adapter.


COLORE FILO WIRE COLOUR	DESCRIZIONE DESCRIPTION	
ROSSO RED	POSITIVO DIRETTO POWER BATTERY	
ARANCIC	POSITIVO SOTTO QUAD POWER SWITCH ON	
NERO BLACK	MASSA GND	
GIALLO	KLINE	
VERDE GREEN	CAN LOW	
BIANCO	CAN HIGH	
GRIGIO GREY	POL4 BOOT	F320037C
BLU BLUE	POL5 CNF1	Personal II
VIOLA/GI PURPLE/0		- WHATHAN -
MARRONI BROWN	RESET	



### **DELPHI F34NTA03 SOLDELRING ADAPTER CONNECTION**





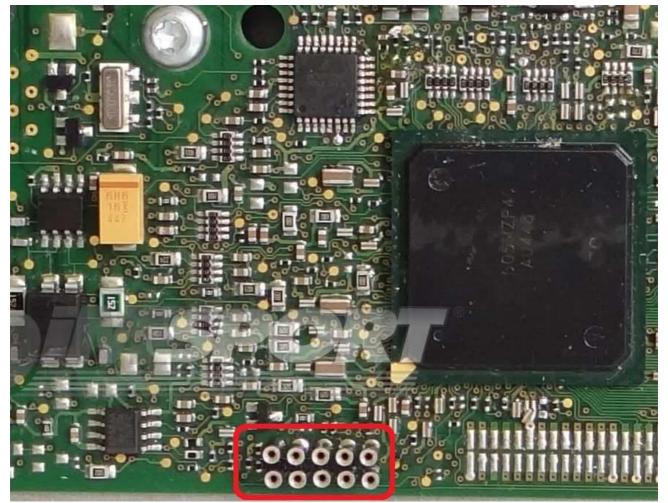



#### METAL POSITIONING FRAME CONNECTION

For the metal positioning frame connection is required the F34DM001 adapter.

