

plugin 1641



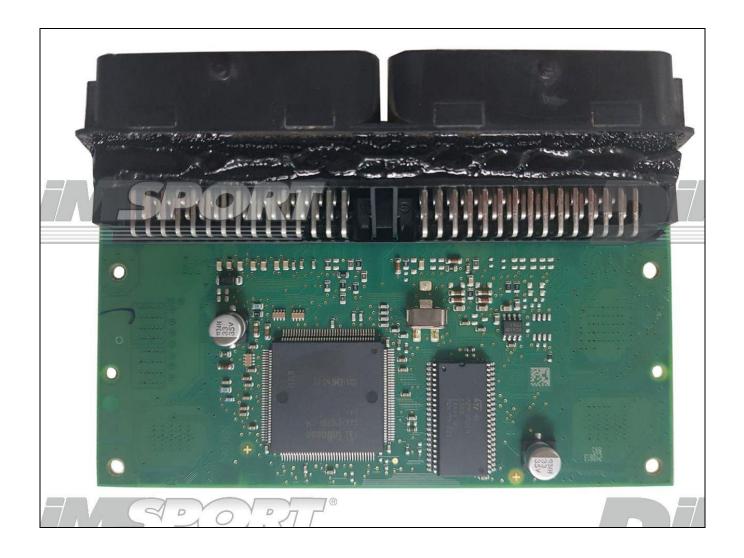

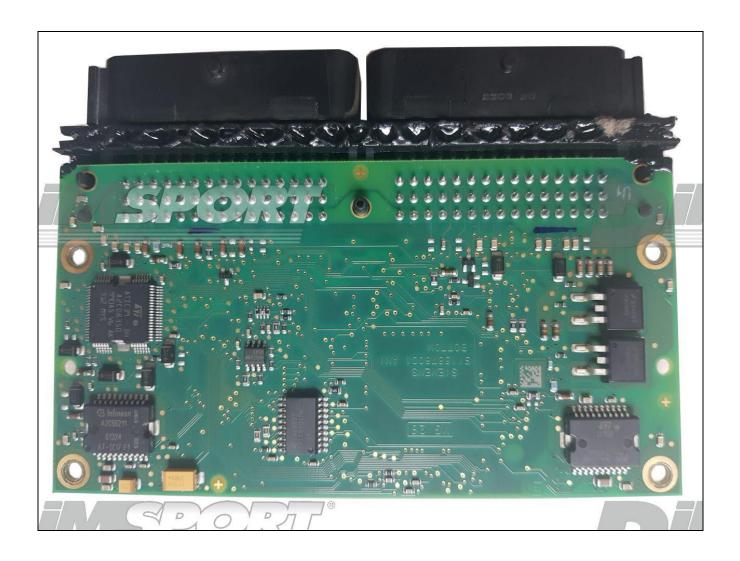

DIRECT CONNECTION

In order to connect to the ECU use the CABLE F32GN037C/D. Make sure that the POWER led (red) on Trasdata is ON.

COLORE FILO	DESCRIZIONE
WIRE COLOUR	DESCRIPTION
ROSSO	POSITIVO DIRETTO
RED	POWER BATTERY
ARANCIO	POSITIVO SOTTO QUADRO
ORANGE	POWER SWITCH ON
NERO	MASSA
BLACK	GND
GIALLO YELLOW	KLINE
VERDE GREEN	CAN LOW
BIANCO WHITE	CAN HIGH
GRIGIO	POL4
GREY	BOOT
BLU	POL5
BLUE	CNF1
VIOLA/GRIGIO	TENSIONE PROG.
PURPLE/GREY	PROG. VOLTAGE
MARRONE BROWN	RESET



ECU CONNECTOR



BOOT CONNECTION

Connect the GREY wire of the cable F32GN037C/D as described here below:

COLORE FILO WIRE COULOR		DESCRIZIONE DESCRIPTION	
	GRIGIO GREY	POL4 BOOT	

